


December 1960

AUTO-VAP MOPED - LIGHTING

If persistent bulb blowing is experienced with either the head or tail lamp bulbs and assuming that the trouble is not being caused by loose bulbs or fittings, we suggest that the following modification be made to the lighting coil:

- (1) Remove the main feed wire from the terminal post. Remove the lighting coil from the Magneclair assembly, this is held in position by two spring clips which can easily be prised away from the coil with a screwdriver.
- (2) Cut the wire at the spring terminal post connection and unwind one complete layer of wire. Cut the wire that has been unwound from the coil leaving sufficient length to connect up to the spring terminal post.
- (3) Scrape the shellac covering from the end of the wire and pass the wire through the terminal post.
- (4) Bind the winding with a few turns of thread or insulated tape to prevent slackening of the winding.
- (5) Replace the coil and reconnect the main feed wire to the terminal post.

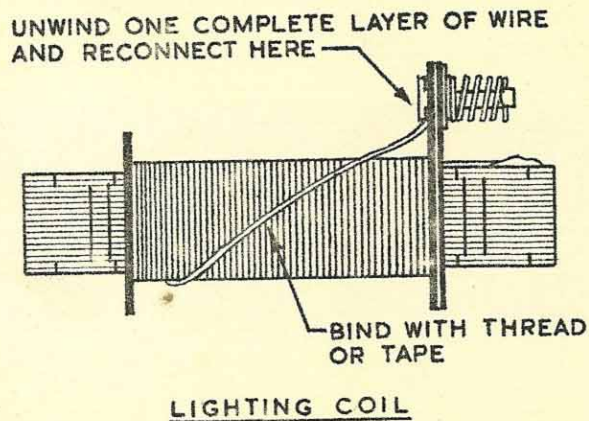

SERVICE DEPARTMENT.

SCOOTAMATIC LTD.,  
155 GLAISDALE DRIVE WEST,,  
ASPLEY,  
NOTTINGHAM.

# IceniCAM Information Service



[www.icenicam.org.uk](http://www.icenicam.org.uk)