

Cyclemaster

LIMITED



SALES DEPARTMENT
154, SHEPHERDS BUSH ROAD,
LONDON, W. 6.
Telephone: RIVerside 3149

HEAD OFFICE & FACTORY
TUDOR WORKS, CHERTSEY ROAD,
BYFLEET · SURREY
Telephone: Byfleet 3145/6/7

PRODUCTS CYCLEMASTER WHEEL
PIATTI SCOOTER

DEPT.

OUR REF.

SERVICE

YOUR REF.

May, 1957.

PIATTI SERVICE BULLETIN NO. 8.

TO ALL PIATTI DEALERS.

PIATTI MUD FLAP.

From Engine no. 4100, the specification of the Piatti Scooter is amended to include a mud flap. This flap is of a strong weather resistant P.V.C. material and is riveted to an angle bracket which, in turn, is secured to the Scooter body cross member which carries the stand.

The mud flap assembly, together with mounting bolts and washers, can be supplied as an accessory for fitting to earlier models. The retail price is 3s. 6d. and is subject to our usual accessories Discount.
EXPORT 2s. 0d.

To fit the mud flap to machines prior to the above, proceed as follows :-

1. Lay the Scooter over on the left-hand side.
2. Remove the two long 5/16" B.S.F. bolts (one each end of the cross member) which pass through the rear of the stand 'U' bracket and cross member.
3. Place the mud flap in position so that the bolts removed (item 2 above) are now located forward of the mud flap assembly and therefore, the flap itself projects downwards and rearwards from the mounting strip.
4. Re-fit the two 5/16" bolts, passing them through the mounting strip of the flap assembly, the stand 'U' bracket and the cross member. Replace the spring washers and nuts and securely tighten. Up to engine no. 3131, 5/16" x 3/4" bolts were used and the nuts placed inside the cross member. To facilitate assembly, the cross members of later models were drilled right through and longer bolts (5/16" x 1.3/8") provided.

If difficulty is experienced in re-fitting the original nuts, it is recommended that the cross member be modified using the underneath hole as a pilot and drilling a 5/16" diameter hole through the top flange of the cross member. Replacement bolts of the longer type will then be necessary.

5. Check the stand to ensure easy operation. This should also be checked with the Scooter upright.

Further copies of this Bulletin are available on request.

11



General

THE UNIVERSITY OF CHICAGO
LIBRARY

Faint, illegible text at the top of the page, possibly bleed-through from the reverse side.

Second section of faint, illegible text.

Third section of faint, illegible text.

Fourth section of faint, illegible text.

Fifth section of faint, illegible text.

Sixth section of faint, illegible text.

Seventh section of faint, illegible text.

IceniCAM Information Service



www.icenicam.org.uk